

 TSB	Model	OPTIMA(TF) (ALL)
	Group	Body Electrical System (92)
	TSB No.	KFE12-92-P020-TF
Subject OPTIMA (TF) AUDIO DISPLAY MALFUNCTION REPAIR	TSB Type	Field Fix
	Published	2012-02-21
	Area & Distributor	Asia, Pacific, South America, C. America, West Europe, East Europe, Middle East, Africa

Description


■ Symptom/Condition

On some Optima (TF) RHD vehicles equipped with CD player audio the “CD-IN” icon (A) might be intermittently indicated on the audio display although no CD is inserted



■ Cause

The eject button (B) does not return completely due to the interference with the center fascia upper panel (C).

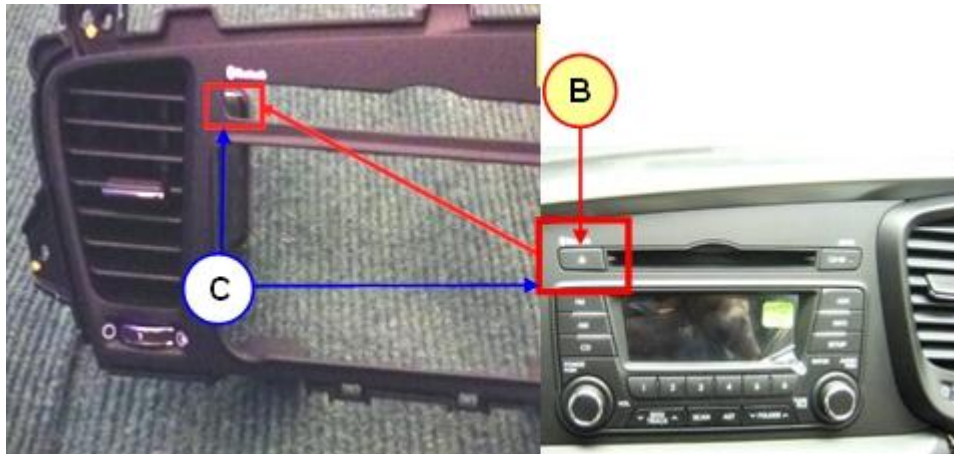

■ Countermeasure

Only for the vehicle exhibiting the condition mentioned above cut the interference part of the center fascia upper panel following the Service Procedure to repair this concern.

Applicable Vehicle

- **Model:** OPTIMA (TF) RHD vehicles equipped with CD player audio
- **Applicable vehicle production date range:** From Dec. 10, 2010 to Dec. 26, 2011
- **Area:** All except North America

Service Procedure

CAUTION

Be careful not to scratch and contaminate any trims during service.

NOTE

- For further information, refer to the applicable Work Shop Manual.

1. Place the ignition switch in the OFF position.
Remove the crash pad lower right panel assembly (A).



2. Remove the crash pad upper right panel assembly (B).
3. Remove the crash pad center left garnish assembly (C).



4. Remove the crash pad center right garnish assembly (D).



5. Remove the cluster fascia panel (E).




6. Remove the center fascia lower panel (F).




7. Remove the center fascia upper panel (G).



8. Using a cutter cut out the interference part (H) from the center fascia upper panel, where blue marking indicates in the right picture.

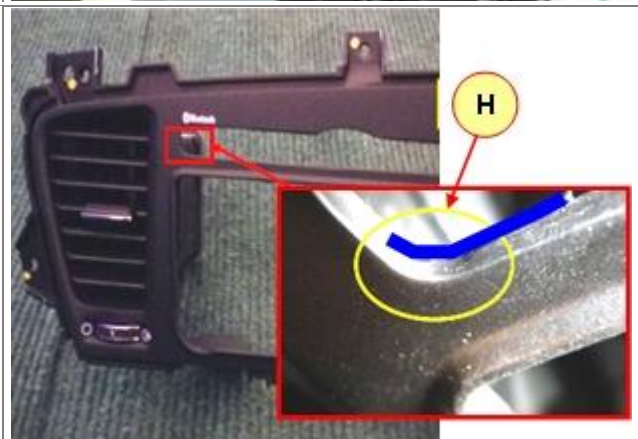

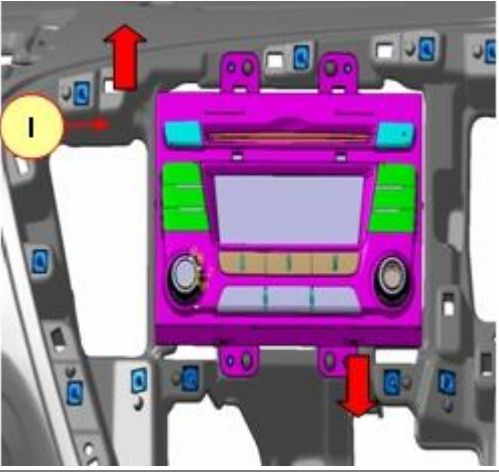9. Lightly loosen all the audio mounting screws without removal. 10. Raise the upper left corner of the audio and lower the lower right corner as much as possible, and then completely refasten all the screws. # I : Audio 11. Reinstall the center fascia upper panel and check that the CD injector button returns normally without any interference.	
12. Reinstall all the removed components in reverse order of removal.	

Operation Code And time

■ WARRANTY INFORMATION

OP CODE	OP NAME	OP TIME	NATURE	CAUSE
96300F03	AUDIO DISPLAY MALFUNCTION REPAIR	0. 6 M/H	N 94	C 15